HEAVY DUTY TOGGLES


Fig. 1


Fig. 2


Fig. 3


Fig. 4


Fig. 5


Fig. 6


Fig. 7


Fig. 8


Fig. 9


Fig. 10


Fig. 11


Fig. 12

Retail Part No.	Bulk Part No.	Fig. No.	Circuit Function	Poles/ Throws	AMPS 125VAC	AMPS 250VAC	HP 125-250VAC	Actuator Style	Actuator Material	Bushing Length	Mounting Hole	Terminal Type	Hardware	Spec. Drawing Page No.
35-078	**35-078-BU**	1	On Off	SPST	15	10	3/4	Bat	Metal	0.465	0.500	Solder	N, KN	277-A
35-143	**35-143-BU**	2	On Off On	4PDT	15	10	3/4	Bat	Metal	0.465	0.500	Screw	N, FN, Sc	277-B
35-145	**35-145-BU**	2	On Off	4PST	15	10	3/4	Bat	Metal	0.465	0.500	Screw	N, FN, Sc	277-B
35-3080	**35-3080-BU**	2	On On	4PDT	15	10	3/4	Bat	Metal	0.465	0.500	Screw	N, FN, Sc	277-B
35-3135	**35-3135-BU**	3	** 1On Off	†	15	10	1/2	Bat	Brass	0.468	0.500	Screw	N, FN, Sc	277-C
35-126	**35-126-BU**	4	On Off	DPST	16	8	1	Bat	Metal	0.465	0.500	Screw	N, FN	277-D
35-3070	**35-3070-BU**	4	On Off	SPST	16	8	1-1/2	Bat	Metal	0.465	0.500	Screw	N, Sc	277-E
35-139	**35-139-BU**	5	On Off	3PST	17	12	1-1/2	Bat	Metal	0.465	0.500	Screw	N, FN, Sc	277-F
35-140	**35-140-BU**	5	On Off On	3PDT	17	12	1-1/2	Bat	Metal	0.465	0.500	Screw	N, FN, Sc	277-F
35-141	**35-141-BU**	5	On On	3PDT	17	12	1-1/2	Bat	Metal	0.465	0.500	Screw	N, FN, Sc	277-F
35-080	**35-080-BU**	6	On Off	SPST	20	10*	3/4	Bat	Metal	0.470	0.500	Screw	N, KN, Sc, ID	277-G
35-110	**35-110-BU**	6	On Off On	SPDT	20	10*	3/4	Bat	Metal	0.470	0.500	Screw	N, KN, Sc	277-H
35-130	**35-130-BU**	6	On On	SPDT	20	10*	3/4	Bat	Metal	0.470	0.500	Screw	N, KN, Sc	277-H
35-144	**35-144-BU**	7	On On	DPDT	20	10*	1-1/2	Bat	Metal	0.465	0.500	Solder	N, KN	277-I
35-146	**35-146-BU**	6	On On	DPDT	20	10*	1-1/2	Bat	Metal	0.470	0.500	Screw	N, KN, Sc	277-I
35-148	**35-148-BU**	6	On Off On	DPDT	20	10*	1-1/2	Bat	Metal	0.470	0.500	Screw	N, KN, Sc	277-I
35-149	**35-149-BU**	7	On Off On	DPDT	20	10	3/4	Bat	Metal	0.465	0.500	Solder	N, KN	277-I
35-150	**35-150-BU**	6	(On) Off (On)	DPDT	20	10*	1-1/2	Bat	Metal	0.470	0.500	Screw	N, KN, Sc	277-I
35-151	**35-151-BU**	6	On Off (On)	DPDT	20	10*	1-1/2	Bat	Metal	0.470	0.500	Screw	N, KN, Sc	277-I
35-153	**35-153-BU**	8	On Off (On)	SPDT	20	10*	3/4	Bat	Metal	0.470	0.500	Screw	N, KN, Sc	277-H
35-155	**35-155-BU**	8	(On) Off (On)	SPDT	20	10*	3/4	Bat	Brass	0.325	0.500	Screw	N, KN, Sc	277-H
35-185	**35-185-BU**	3	On Off	DPST	20	10*	1-1/2	Bat	Metal	0.465	0.500	QC .250″	N, KN	277-J
35-3005	**35-3005-BU**	9	On Off	SPST	20	10	3/4	Bat	Brass	0.325	0.500	QC .250″	N, KN	277-K
35-3010	**35-3010-BU**	9	On On	SPDT	20	10	3/4	Bat	Brass	0.325	0.500	QC .250″	N, KN	277-K
35-3015	**35-3015-BU**	9	On Off On	SPDT	20	10	3/4	Bat	Brass	0.325	0.500	QC .250″	N, KN	277-K
35-3020	**35-3020-BU**	7	On On	DPDT	20	10*	1-1/2	Bat	Brass	0.468	0.500	QC .250″	N, KN	277-L
35-3025	**35-3025-BU**	7	On Off On	DPDT	20	10*	1-1/2	Bat	Brass	0.468	0.500	QC .250″	N, KN	277-L
35-3045	**35-3045-BU**	10	On Off	DPST	20	10	3/4	Bat	Brass	0.468	0.500	QC .250″	N, KN	277-M
35-3055	**35-3055-BU**	9	Off (On)	SPST	20	10	3/4	Bat	Brass	0.468	0.500	QC .250″	N, KN	277-K
35-3056	**35-3056-BU**	9	On Off	SPST	20	10	3/4	Bat	Brass	0.325	0.500	Solder	N.KN	277-K
35-3060	**35-3060-BU**	3	On Off	DPST	20	10*	1-1/2	Bat	Brass	0.468	0.500	Screw	N, KN, Sc	277-N
35-3075	**35-3075-BU**	11	On Off	DPST	20	10	1-1/2	Bat	Brass	0.465	0.500	Screw	N, Sc	277-E
35-3170	**35-3170-BU**	12	On Off	SPST	***	***	1/2	Bat	Brass	0.500	0.438	Screw	KN, Sc	277-O


Notes: (On)/(Off)=Momentary On/Off
*Rated @ 277VAC
**1&2 On
***Rated 35A @ 6VDC/20A @ 12VDC
FN=Face Nut
†=Progressive Two Circuit
ID=ID Plate
KN=Knurled Nut
N=Nut
QC=Quick Connect
Sc=Screw

Note: All figures are for illustration purpose only, and the number/type of terminals may vary.


Phone (815)316-9080•Fax (815)316-9081

All quantities are single; BU's are packages of 10 Unless otherwise noted.


A

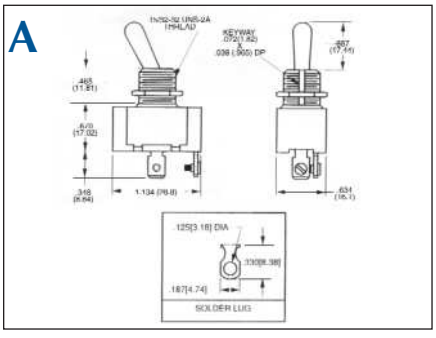


B

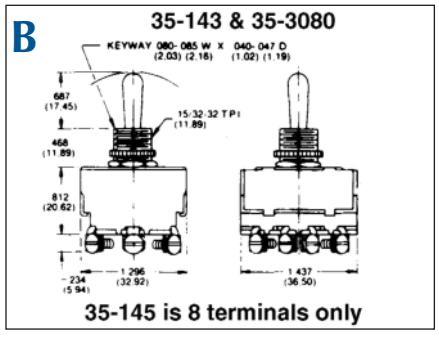


C

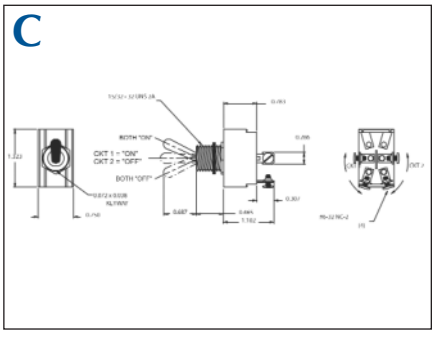


D

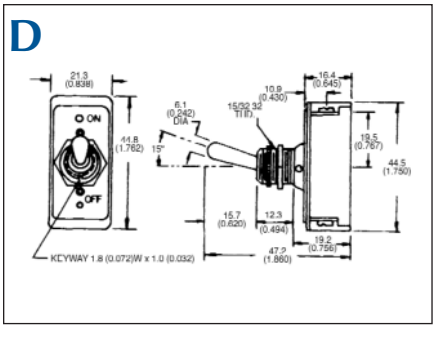


E

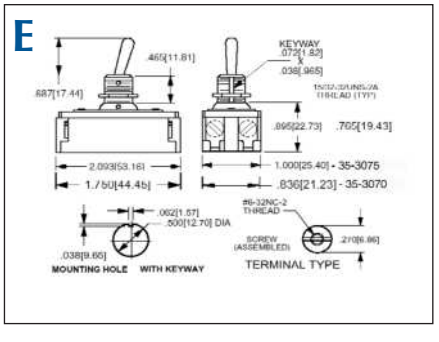


F

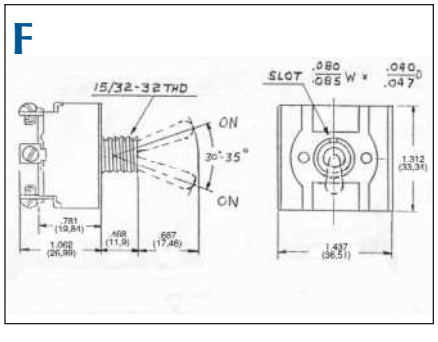


G

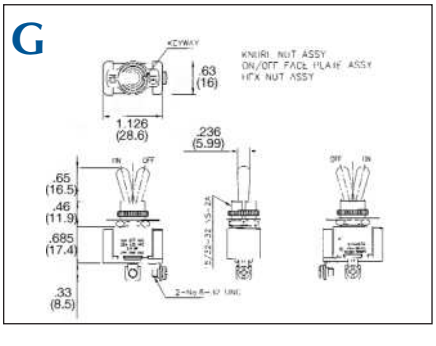


H

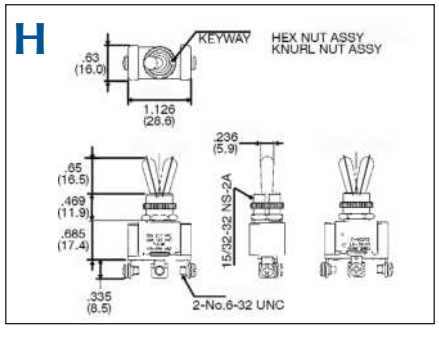


I

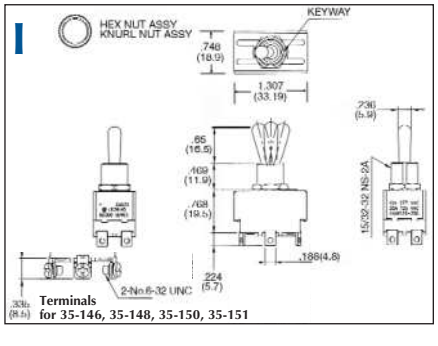


J

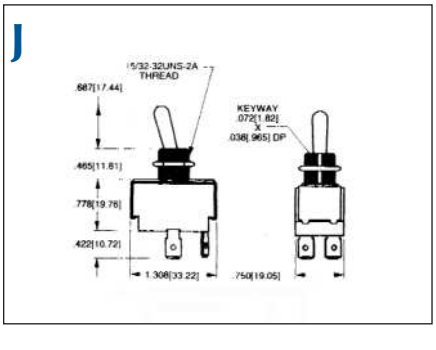


K

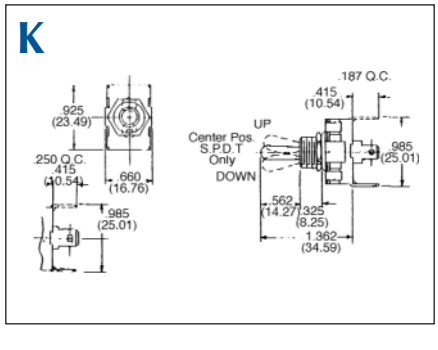


L

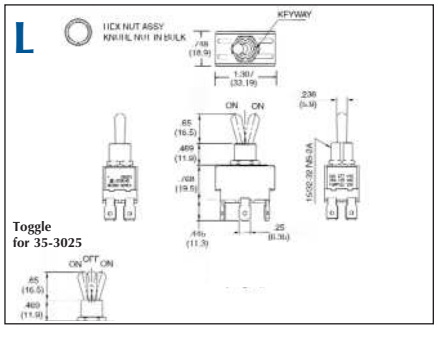

M

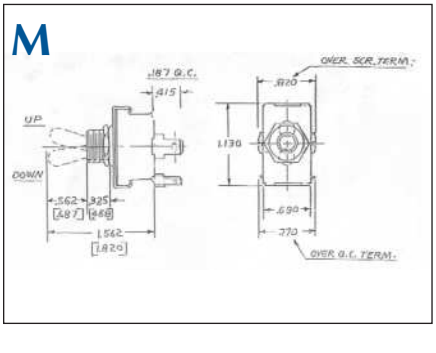

N

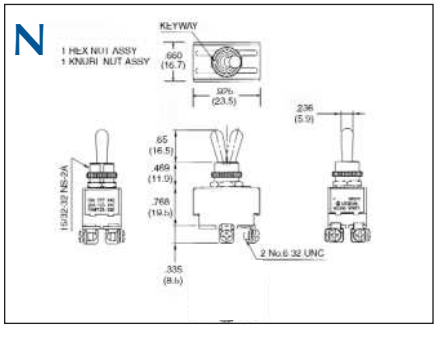

O

