
INSPECTION LIST

- ❑ **Perform cosmetic inspection.**
- ❑ **Verify label reads with VL-CBL-8002.**
- ❑ **Verify that connectors are installed the correct direction.**
- ❑ **Verify that connectors are properly terminated.**
- ❑ **Verify length of cable C (including connector) are 13" ± .25, verify length of cable A & B (including connector) is 19"± .25"**
- ❑ **Verify pin 1 arrows align with red strips.**
- ❑ **Verify pins 10B to 16B have a twist in the cable.**
- ❑ **Verify that there are no connections to pins 7 to 10 on XMA10M.**
- ❑ **Verify that there is no polarization key on 34 pin connector.**
- ❑ **Verify that there is a polarize key on the 40-pin connector.**
- ❑ **Verify that IDC connector is properly crimped.**

ASSEMBLY



ASSEMBLY

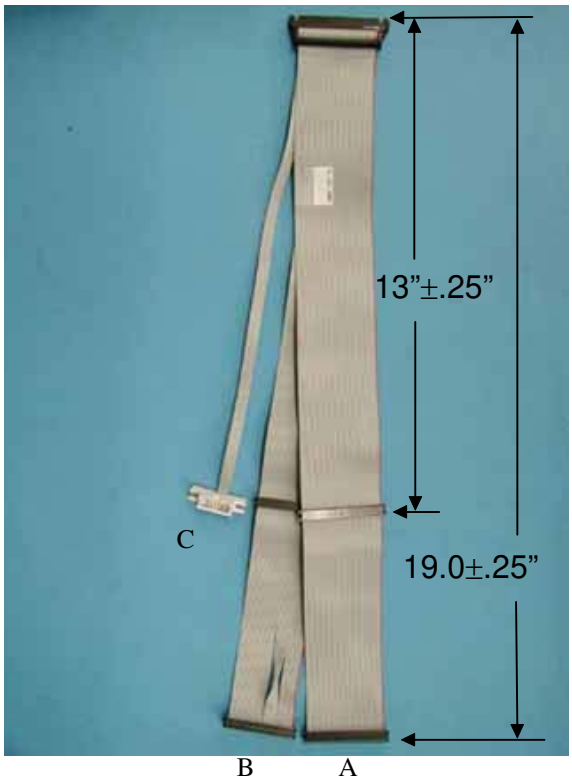